



BANDING TOOL INSTRUCTIONS:

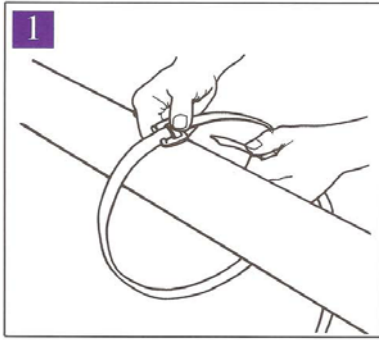


To completely eliminate waste, the band may be used from a bulk roll. Slide Buckle on to the band as shown, bringing end of band around the object to be clamped and again through buckle.

NOTE: Lubricate banding tool regularly.

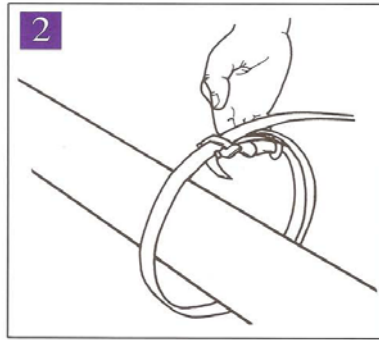

Continue band around the object once more and again through the buckle. Bend end of band under buckle.


NOTE: Double banding develops more radial compression than single banding.

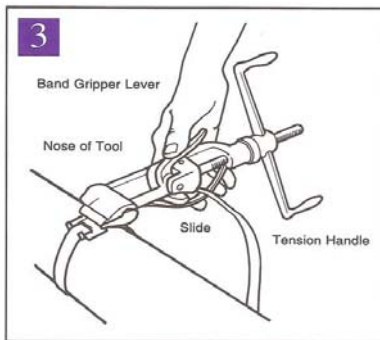

Position band in open slot of tool nose and into the slide. To apply tension, place thumb on band gripper lever and turn handle of tool. When tension is created, release band gripper lever as it locks itself under tension.




To tension, place finger on band at buckle bridge while turning tool handle clockwise. **Maximum pressure is being exerted** when the band stops moving through the buckle around object being clamped. **Stop turning handle.**

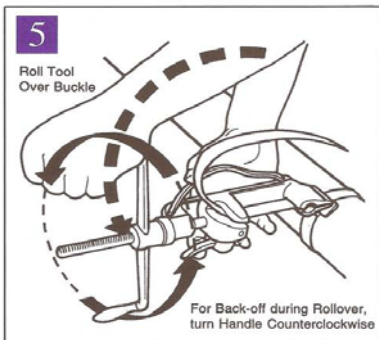


Roll tool over buckle and back-off with tension handle throughout entire rolling operation. Failure to back-off throughout entire course of roll may result in the band breaking.


NOTE: There is no loss of tension as band released is used up in the bend

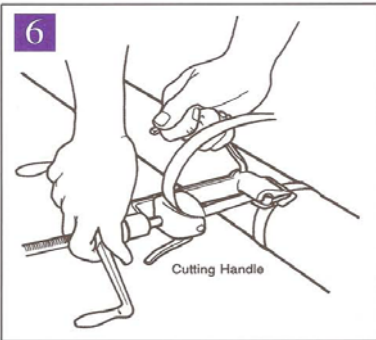

Pull cutting handle to cut the band.

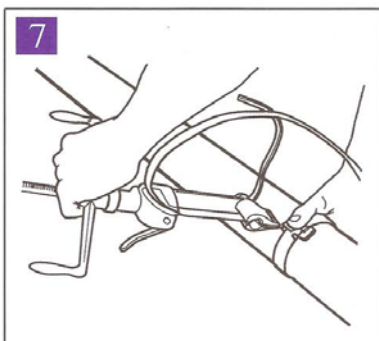

Holding stub of band down with thumb, Remove tool.

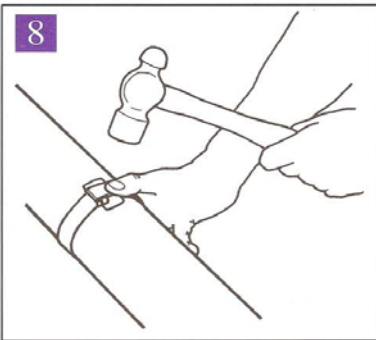

To complete clamp, clinch stub by hammering down buckle ears